SALES REPORT: CATERPILLAR M325DMH - SN EDF02006 - Year 2011

This Report is a summary about observations cames out from technical inspection done by our specialised technician.

GENERAL CONDITIONS

MACHINE DATA

Model: M325DMH

Family: WHEEL EXCAVATOR

Serial Number: EDF02006

Order Number MU/MM: MU00704305

Construction year: 2011

Hour meter: 17125

General residual conditions Truck/Tyres: 15 %

Machine main application: Industry - not corrosive field

Location: Stock Villa Autotrasp

Rating: ★★★☆☆

Public price: 44.000 €

MACHINE CONFIGURATION

● Machine type Material Handling MH ● Boom type Parallelogramm ● Boom check valves ● Stick check valves ● Plant features Versatility ● Tyres type Twin Wheel ● General Tyres Residual 15 123 non rilevato ● Stabilizers 4 Stabilizers ● Cabin type Hydraulic lift ● Cabin fog Front ● Air Conditioning system Operation Yes Operation No ● 1 Kg ● CE Mark ● CE Certificate ● Use and maintenance manual ● Registration book & Licence plate No Registration book & Licence plate

MACHINE PHOTOS

- Il contaore e': Funzionante

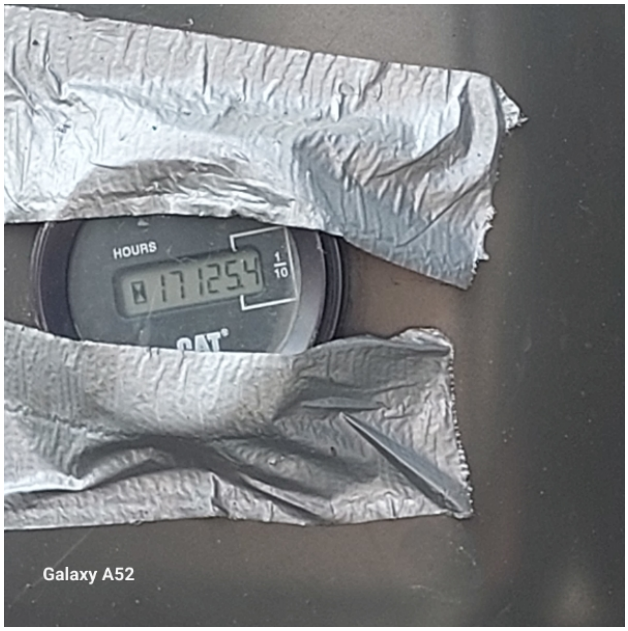









Galaxy A52


HOURS
Galaxy A52


Galaxy A52


Galaxy A52







GENERAL APPEARANCE

Painting Conditions	Poor
Counterweight conditions	Poor
	Needs painting? : No
Frame / Bumper conditions	Good

Tyres

Front Tyres residual	5
Front Tyres residual	5

Right side

Door conditions (right)	Good
Spar conditions (right)	Good

Left side

Door conditions (left)	Good
Door conditions (left)	Good
Spar conditions (left)	Good
Hood / Armor bottom conditions	Present and intact

Functionality

Engine & electrical system functionality

In quale stato è stata visionata la macchina:	Spenta e ferma
Engine functionality conditions	Poor
Engine with oil leaks	Yes
	If Yes, where : trasudamenti vari nella norma e compatibili per le ore attuali
Engine presents blowby	No

- Oil-Water presence: No
- Engine present smokiness: No
- Radiator conditions: Good
- Starter motor conditions: Good
- Batteries/Cables conditions: Good
- Presence of electrical fault: Sì

If present, add details : servizio cgt a verificato necessità di valutare riparazioni o sostituzione cablaggi (centraline) problemi elettrici che limitano l'uso di alcune funzione della macchina.

- Annotazioni sul: da ricoverare in officina per valutare interventi

Functionality drive and rotation

- Hydraulic pump conditions: Poor
- Engine rotation conditions: Poor
- Engine travel conditions: Good
- Final drives conditions: Good
- Hydraulic joint conditions: Good

  Presence of leaks : No
- Hydraulic joint conditions: Good

  Presence of leaks : No
- Tenuta idraulica braccio (il braccio cala): No

Linkage Group

- Hydraulic conditions linkage group (Boom is lowering?): Yes

Boom structure	Good
	Presence of welding/cracks : No
Stick structure	Good
	Presence of welding/cracks : No
Flexible pipes conditions	Poor
Boom cylinders conditions	Good
	Leaks : No
Stick cylinder conditions	Good
	Leaks : No
Bucket / Grapple cylinder conditions	Good
	Leaks : No
Pins & Bushings boom conditions	Good
Pins & Bushings stick conditions	Poor
Pins & Bushings bucket conditions	Good
Bucket / Grapple & Get conditions	NA - Not applicable
Quick Coupler conditions	NA - Not applicable
Funzionamento Impianto Ingrassaggio Automatico:	No

Cabin and Tools

Conditions internal cabin	Good
Flashing presents issues	No
Lights & Windshield present issues	Present and not functioning
Air contidioning & Filters conditions	Presents and functioning

Back & side camera conditions	Not functioning

Check 81/2008

Condizioni freni:	Buono
Condizioni freno di Stazionamento:	Buono
Glass conditions	Broken or Chipped - needs repair
Lights conditions	Broken or Chipped - needs repair
Rear view mirrors conditions	Broken or Chipped - needs repair
Stepladders & handrails conditions	Poor
Cameras conditions	Broken or Chipped - needs repair
Flashing conditions	Not functioning
Safety belt conditions	Present and expired
Controls been modified	No
Presence of Exclusion Control Lever	Yes
	If No, are control levers protected to accidental funcionality? : No
Are Tools Functional & Visible with tag	Yes
Canopy completed and comes with keys and bolt	Yes
All Pipes with no damage e/o scratches	Yes
Batteries box shielded	No
Acustic alarm works properly	Yes
Boardwalk presence	Present and functioning

Valutazione Macchina

★ **Non Funzionante (NF)**

La macchina si presenta non funzionante e/o in pessime condizioni. Macchina da demolire o venduta per parti di ricambio. La macchina NON è in sicurezza.

★★ **Scarso (S)**

La macchina è in cattivo stato e può presentare visibili rotture e/o crepe su tutta la struttura. Per il suo ottimale funzionamento, o per essere avviata, può necessitare di importanti riparazioni a carro/gomme, perdite d'olio, riverniciatura completa, componenti principali, messa in sicurezza.

★★★ **Buono (B)**

La macchina si presenta in buone condizioni sia estetiche che di funzionamento.
Carro/Gomme hanno orientativamente un 30/40% di vita residua. La macchina non presenta importanti rotture e/o perdite d'olio. La macchina è pronta per lavorare "AS IS" anche se potrebbe richiedere piccoli interventi di riparazione/migliorie. La macchina è in sicurezza.

★★★★ **Molto Buono (O)**

La macchina si presenta in condizioni molto buone, non ha più di 5 anni e/o 5000 ore lavorate.
Non presenta problemi strutturali e può essere preparata esteticamente per renderla "quasi nuova".
Componenti principali non inferiori al 50/60% di vita residua, macchina in sicurezza.

★★★★★ **Eccellente (E)**

La macchina si presenta in condizioni eccellenti, prossime al nuovo.
Componenti principali non inferiori al 70/80% di vita residua, macchina in sicurezza.

Machine Rating

★ **Not Working (NW)**

Machine not operational or in really bad conditions. Machine has to be demolished or sold as a "parts". Machine not in security conditions.

★★ **Poor (P)**

Machine in bad condition, got visible cracks or repairable structural issues. Machine is operational but, in order to work properly, it may need significant repairs to tyres/truck, paint, pins and/or bushings, power train, hydraulic system.

★★★ **Good (G)**

Machine is in good condition and operational, with no structural issues.
Tyres/Track around 30/40% of residual life. No relevant hydraulic leaks, pins/bushings with normal wear, frame may need to be repainted.
Machine is ready to work "AS IS", it may need minor repairs for a better performance. Machine in security conditions or easy to be in safety condition.

★★★★ **Very Good (VG)**

Machine is in very good conditions, with no more of 5 years and/or 5000 working hours.
No structural issues; painting condition is almost perfect. May need an easy check to be sold as "Brand New".
Main components with 50/60% of life residue. Machine in security conditions.

★★★★★ **Excellent (E)**

Machine is in excellent condition, comparable to a new one.
Main components with 70/80% of life residue. Machine in security conditions.