

SALES REPORT: CATERPILLAR 330 NG - SN XNB20110 - Year 2022

This Report is a summary about observations comes out from technical inspection done by our specialised technician.

GENERAL CONDITIONS

MACHINE DATA

Model: 330 NG

Family: MEDIUM EXCAVATOR

Serial Number: XNB20110

Order Number MU/MM: MM00576904

Construction year: 2022

Hour meter: 3648

General residual conditions Truck/Tyres: 60 %

Machine main application: Basic application

Location: Out for hire


Rating: ★★★☆☆

Public price: 240.000 €


MACHINE CONFIGURATION

- Machine type Standard
- Boom type Mono boom
- Boom check valves
- Stick check valves
- Plant features Versatility
- Quick coupler Hydraulic
- Bucket Standard
- Truck type Fixed
- General Truck Residual 60%
- Cabin type Fixed standard
- Cabin fog Front superiore
- Air Conditioning system
- Product Link
- 19000 Kg
- CE Mark
- CE Certificate
- NPKXL07.0VM1-013 EPA

MACHINE PHOTOS

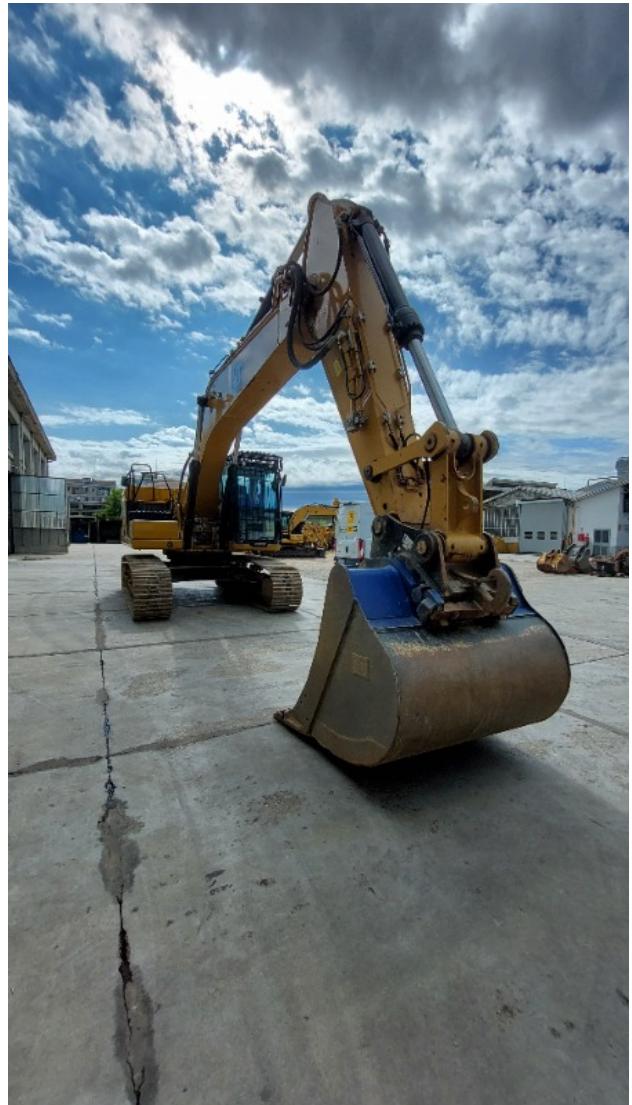



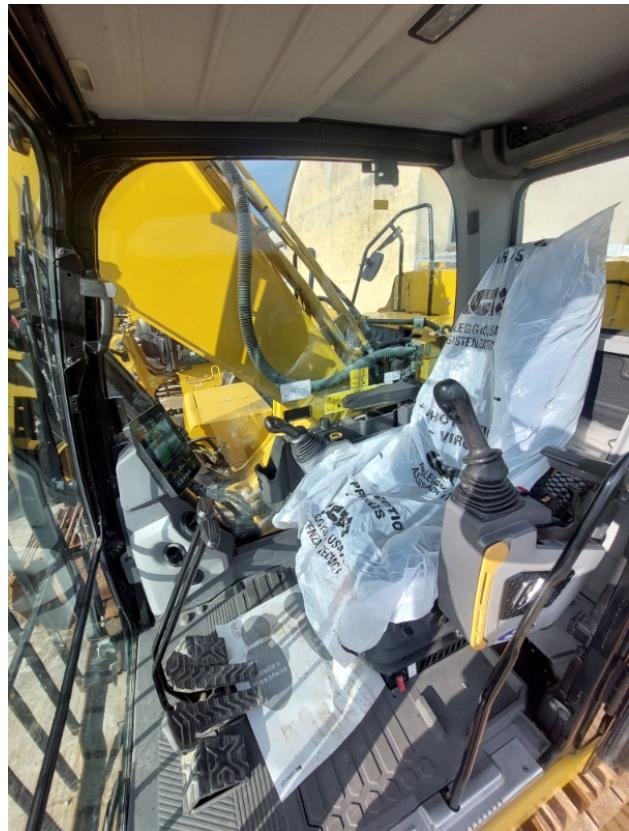

GENERAL APPEARANCE

◆ Painting Conditions Good

◆ Counterweight conditions: Good

◆ Frame/Bumper conditions: Good

TRUCK

◆ Sprockets residual: 60

◆ Front idler wheel residual: 60

◆ Rollers upper/bottom residual: 60

◆ Chains residual: 60

Right side

◆ Door conditions (right): Good

◆ Spar conditions: Good

Left side

◆ Door conditions (left): Good

◆ Door conditions (left): Good

◆ Spar conditions (left): Good

◆ Other notes

◆ Hood/Armor bottom conditions: Present and intact

Functionality

Engine & electrical system functionality

- ◆ In quale stato è stata visionata la macchina: Accesa e funzionante "al lavoro"
- ◆ Engine working conditions: Good
- ◆ Engine with oil leaks: No
- ◆ Engine presents blowby: No
- ◆ Oil-Water presence: No
- ◆ Engine present smokiness: No
- ◆ Radiator conditions: Good
- ◆ Starter motor conditions: Good
- ◆ Batteries/Cables conditions: Good
- ◆ Presence of electrical fault: No

Functionality drive and rotation

- ◆ Hydraulic pump conditions: Good
- ◆ Engine rotation conditions: Good
- ◆ Engine travel conditions: Good
- ◆ Final drives conditions: Good
- ◆ Hydraulic joint conditions: Good

Presence of leaks : No

◆ Hydraulic joint conditions:	Good
	Presence of leaks : No

Linkage Group

◆ Hydraulic conditions linkage group:	No
◆ Boom structure:	Good
	Presence of welding/cracks : No
◆ Stick structure:	Good
	Presence of welding/cracks : No
◆ Flexible pipes conditions:	Good
◆ Boom cylinders conditions:	Good
	Leaks : No
◆ Stick cylinder conditions:	Good
	Leaks : No
◆ Bucket cylinder conditions:	Good
	Leaks : No
◆ Pins & Bushings boom conditions:	Good
◆ Pins & Bushings stick conditions:	Good
◆ Pins & Bushings bucket conditions:	Good
◆ Bucket & Get conditions:	Good
◆ Quick Coupler conditions:	Good
◆ Auto Lube working conditions:	No

Cabin and Tools

◆ Conditions internal cabin:	Good
◆ Flashing presents issues:	Yes
◆ Lights & Windshield present issues:	Presents and functioning
◆ Air conditioning is working:	Presente e funzionante
◆ Back & side camera conditions:	Present and functioning

Check 81/2008

◆ Glass conditions:	Excellent - no needs repair
◆ Lights conditions:	Excellent - no needs repair
◆ Rear view mirrors conditions:	Excellent - no needs repair
◆ Stepladders & handrails conditions:	Very good
◆ Cameras conditions:	Excellent - no needs repair
◆ Flashing conditions:	Present and functioning
◆ Safety belt conditions:	Present and valid
◆ Controls been modified:	No
◆ Presence of Exclusion Control Lever:	Yes
◆ Are Tools Functional & Visible with tag:	Yes
◆ Canopy completed and comes with keys and bolt:	Yes
◆ All Pipes with no damage e/o scratches:	Yes
◆ Batteries box shielded:	Yes

◆ Acoustic alarm works properly: Yes

◆ Boardwalk presence: Present and functioning

Valutazione Macchina

★ Non Funzionante (NF)

La macchina si presenta non funzionante e/o in pessime condizioni. Macchina da demolire o venduta per parti di ricambio. La macchina NON è in sicurezza.

★★ Scarso (S)

La macchina è in cattivo stato e può presentare visibili rotture e/o crepe su tutta la struttura. Per il suo ottimale funzionamento, o per essere avviata, può necessitare di importanti riparazioni a carro/gomme, perdite d'olio, riverniciatura completa, componenti principali, messa in sicurezza.

★★★ Buono (B)

La macchina si presenta in buone condizioni sia estetiche che di funzionamento.

Carro/Gomme hanno orientativamente un 30/40% di vita residua. La macchina non presenta importanti rotture e/o perdite d'olio. La macchina è pronta per lavorare "AS IS" anche se potrebbe richiedere piccoli interventi di riparazione/migliorie. La macchina è in sicurezza.

★★★★★ Molto Buono (O)

La macchina si presenta in condizioni molto buone, non ha più di 5 anni e/o 5000 ore lavorate.

Non presenta problemi strutturali e può essere preparata esteticamente per renderla "quasi nuova".

Componenti principali non inferiori al 50/60% di vita residua, macchina in sicurezza.

★★★★★ Eccellente (E)

La macchina si presenta in condizioni eccellenti, prossime al nuovo.

Componenti principali non inferiori al 70/80% di vita residua, macchina in sicurezza.

Machine Rating

★ Not Working (NW)

Machine not operational or in really bad conditions. Machine has to be demolished or sold as a "parts". Machine not in security conditions.

★★ Poor (P)

Machine in bad condition, got visible cracks or repairable structural issues. Machine is operational but, in order to work properly, it may need significant repairs to tyres/truck, paint, pins and/or bushings, power train, hydraulic system.

★★★ Good (G)

Machine is in good condition and operational, with no structural issues.

Tyres/Track around 30/40% of residual life. No relevant hydraulic leaks, pins/bushings with normal wear, frame may need to be repainted.

Machine is ready to work "AS IS", it may need minor repairs for a better performance. Machine in security conditions or easy to be in safety condition.

★★★★★ Very Good (VG)

Machine is in very good conditions, with no more of 5 years and/or 5000 working hours.

No structural issues; painting condition is almost perfect. May need an easy check to be sold as "Brand New".

Main components with 50/60% of life residue. Machine in security conditions.

★★★★★ Excellent (E)

Machine is in excellent condition, comparable to a new one.

Main components with 70/80% of life residue. Machine in security conditions.