

## SALES REPORT: KOMATSU PC450#KKOMA - SN K45### - Year 2006

This Report is a summary about observations came out from technical inspection done by our specialised technician.

### GENERAL CONDITIONS

---

### MACHINE DATA

---

**Model:** PC450#KKOMA

**Family:** MEDIUM EXCAVATOR

**Serial Number:** K45###

**Order Number MU/MM:** MU00809811

**Construction year:** 2006

**Hour meter:** 15621

**General residual conditions Truck/Tyres:** 30 %

**Machine main application:** Basic application, Heavy application

**Machine availability date :** 27/02/2026

**Location:** Coming in

**Rating:** ★★☆☆☆

**Public price:** 217.500 €

### MACHINE CONFIGURATION

---

● Machine type Standard demolition ● Boom type Mono boom demolizione ● Plant features Hammer/Crusher line impianto versatility (linea media/alta pressione + rotazione) ● Bucket Standard Std Get Teeth ● Truck type Mechanic extendible ● General Truck Residual 30% ● Cabin type Fixed standard ● Cabin fog Front ● Air Conditioning system ● 44665 Kg ● CE Mark ● CE Certificate Braccio da Demolizione in possesso del cliente (sito in altro impianto); Il cliente dichiara che la macchina è funzionante anche con il braccio da Demolizione; N.2 benne;

## MACHINE PHOTOS

---


◆ Il contaore è:

Funzionante









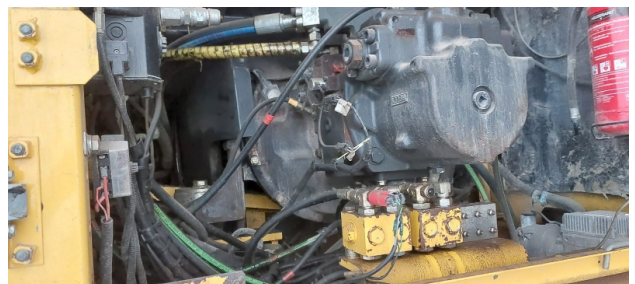



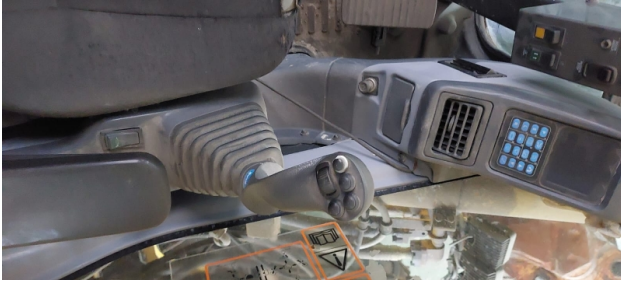

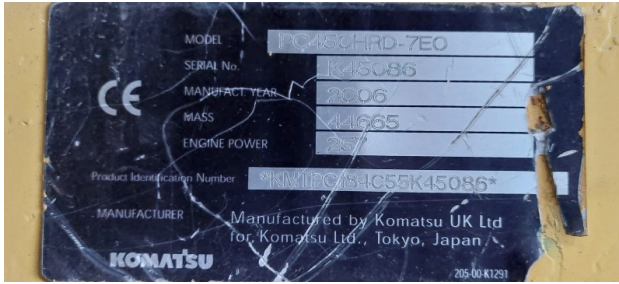

## GENERAL APPEARANCE

|                             |      |
|-----------------------------|------|
| ◆ Painting Conditions       | Poor |
| ◆ Counterweight conditions: | Poor |
| ◆ Frame/Bumper conditions:  | Poor |

## TRUCK

|                                  |    |
|----------------------------------|----|
| ◆ Sprockets residual:            | 30 |
| ◆ Front idler wheel residual:    | 30 |
| ◆ Rollers upper/bottom residual: | 30 |
| ◆ Chains residual:               | 30 |

## Right side

|                            |                     |
|----------------------------|---------------------|
| ◆ Door conditions (right): | Poor                |
| ◆ Spar conditions:         | Poor                |
| ◆ Other issues:            | Segni strusciature; |

## Left side

|                                 |                  |
|---------------------------------|------------------|
| ◆ Door conditions (left):       | Poor             |
| ◆ Door conditions (left):       | Poor             |
| ◆ Spar conditions (left):       | Poor             |
| ◆ Hood/Armor bottom conditions: | Present and bash |

## Functionality

### Engine & electrical system functionality

|                                                 |                         |
|-------------------------------------------------|-------------------------|
| ◆ In quale stato è stata visionata la macchina: | Spenta e ferma          |
| ◆ Engine working conditions:                    | Good                    |
| ◆ Engine with oil leaks:                        | Yes                     |
|                                                 | If Yes, where : Trasudi |
| ◆ Engine presents blowby:                       | No                      |
| ◆ Oil-Water presence:                           | No                      |
| ◆ Engine present smokiness:                     | No                      |
| ◆ Radiator conditions:                          | Good                    |
| ◆ Starter motor conditions:                     | Good                    |
| ◆ Batteries/Cables conditions:                  | Not working             |
| ◆ Presence of electrical fault:                 | No                      |

SE SI, AGGIUNGERE DETTAGLI : Da controllare impianto elettrico; macchina spenta e ferma;

### Functionality drive and rotation

◆ Hydraulic pump conditions: Good

◆ Engine rotation conditions: Good

◆ Engine travel conditions: Good

◆ Final drives conditions: Good

◆ Hydraulic joint conditions: Good

Presence of leaks : No

◆ Hydraulic joint conditions: Good

Presence of leaks : No

## Linkage Group

◆ Hydraulic conditions linkage group: No

◆ Boom structure: Good

Presence of welding/cracks : No

◆ Stick structure: Good

Presence of welding/cracks : No

◆ Flexible pipes conditions: Poor

◆ Boom cylinders conditions: Poor

Leaks : Yes

◆ Stick cylinder conditions: Poor

Leaks : Yes

◆ Bucket cylinder conditions: Poor

Leaks : Yes

◆ Pins & Bushings boom conditions: Good

◆ Pins & Bushings stick conditions: Poor



|                                      |                     |
|--------------------------------------|---------------------|
| ◆ Pins & Bushings bucket conditions: | Poor                |
| ◆ Bucket & Get conditions:           | Poor                |
| ◆ Quick Coupler conditions:          | NA - Not applicable |
| ◆ Auto Lube working conditions:      | No                  |

## Cabin and Tools

|                                                         |                             |
|---------------------------------------------------------|-----------------------------|
| ◆ Conditions internal cabin:                            | Poor                        |
| Other notes : Cabina da sistemare; sedile da sistemare; |                             |
| ◆ Flashing presents issues:                             | No                          |
| ◆ Lights & Windshield present issues:                   | Present and not functioning |
| ◆ Air conditioning is working:                          | Presente e non funzionante  |
| ◆ Back & side camera conditions:                        | Not functioning             |

## Check 81/2008

|                                       |                                  |
|---------------------------------------|----------------------------------|
| ◆ Glass conditions:                   | Excellent - no needs repair      |
| ◆ Lights conditions:                  | Broken or Chipped - needs repair |
| ◆ Rear view mirrors conditions:       | Mancanti                         |
| ◆ Stepladders & handrails conditions: | Poor                             |
| ◆ Cameras conditions:                 | Broken or Chipped - needs repair |
| ◆ Flashing conditions:                | Not functioning                  |
| ◆ Safety belt conditions:             | Not present/Broken               |

|                                                  |             |
|--------------------------------------------------|-------------|
| ◆ Controls been modified:                        | No          |
| ◆ Presence of Exclusion Control Lever:           | Yes         |
| ◆ Are Tools Functional & Visible with tag:       | No          |
| ◆ Canopy completed and comes with keys and bolt: | No          |
| ◆ All Pipes with no damage e/o scratches:        | No          |
| ◆ Batteries box shielded:                        | Yes         |
| ◆ Acoustic alarm works properly:                 | No          |
| ◆ Boardwalk presence:                            | Not present |

## Valutazione Macchina

### ★ Non Funzionante (NF)

La macchina si presenta non funzionante e/o in pessime condizioni. Macchina da demolire o venduta per parti di ricambio. La macchina NON è in sicurezza.

### ★★ Scarso (S)

La macchina è in cattivo stato e può presentare visibili rotture e/o crepe su tutta la struttura. Per il suo ottimale funzionamento, o per essere avviata, può necessitare di importanti riparazioni a carro/gomme, perdite d'olio, riverniciatura completa, componenti principali, messa in sicurezza.

### ★★★ Buono (B)

La macchina si presenta in buone condizioni sia estetiche che di funzionamento. Carro/Gomme hanno orientativamente un 30/40% di vita residua. La macchina non presenta importanti rotture e/o perdite d'olio. La macchina è pronta per lavorare "AS IS" anche se potrebbe richiedere piccoli interventi di riparazione/migliorie. La macchina è in sicurezza.

### ★★★★ Molto Buono (O)

La macchina si presenta in condizioni molto buone, non ha più di 5 anni e/o 5000 ore lavorate. Non presenta problemi strutturali e può essere preparata esteticamente per renderla "quasi nuova". Componenti principali non inferiori al 50/60% di vita residua, macchina in sicurezza.

### ★★★★★ Eccellente (E)

La macchina si presenta in condizioni eccellenti, prossime al nuovo. Componenti principali non inferiori al 70/80% di vita residua, macchina in sicurezza.

## Machine Rating

### ★ Not Working (NW)

Machine not operational or in really bad conditions. Machine has to be demolished or sold as a "parts". Machine not in security conditions.

### ★★ Poor (P)

Machine in bad condition, got visible cracks or repairable structural issues. Machine is operational but, in order to work properly, it may need significant repairs to tyres/truck, paint, pins and/or bushings, power train, hydraulic system.

### ★★★ Good (G)

Machine is in good condition and operational, with no structural issues. Tyres/Track around 30/40% of residual life. No relevant hydraulic leaks, pins/bushings with normal wear, frame may need to be repainted. Machine is ready to work "AS IS", it may need minor repairs for a better performance. Machine in security conditions or easy to be in safety condition.

### ★★★★ Very Good (VG)

Machine is in very good conditions, with no more of 5 years and/or 5000 working hours. No structural issues; painting condition is almost perfect. May need an easy check to be sold as "Brand New". Main components with 50/60% of life residue. Machine in security conditions.

### ★★★★★ Excellent (E)

Machine is in excellent condition, comparable to a new one. Main components-with 70/80% of life residue. Machine in security conditions.