

SALES REPORT: CATERPILLAR 312D - SN RKF00### - Year 2011

This Report is a summary about observations comes out from technical inspection done by our specialised technician.

GENERAL CONDITIONS

MACHINE DATA

Model: 312D

Family: SMALL EXCAVATOR

Serial Number: RKF00###

Order Number MU/MM: MU00811672

Construction year: 2011

Hour meter: 12500

General residual conditions Truck/Tyres: 40 %

Machine main application: Basic application

Machine availability date : 31/03/2026

Location: Coming in

Rating: ★★☆☆☆

Public price: Ask

MACHINE CONFIGURATION

• Machine type Standard • Boom type Mono boom • Boom check valves • Stick check valves • Plant features Hammer/Crusher line impianto dedicato all'attacco rapido • Quick coupler Hydraulic La macchina verrà consegnata con attacco rapido id Cat CW E BENNA della macchina che acquista cat 313 gc • Bucket Standard 1200 Get Teeth • Truck type Fixed • General Truck Residual 40% • Cabin type Fixed standard • Cabin fog Upper • Air Conditioning system • 16600 Kg • CE Mark • CE Certificate • Use and maintenance manual • AVAILABLE FROM APRIL


MACHINE PHOTOS

◆ Il contaore è:


Sostituito

Letture stimata : 12500



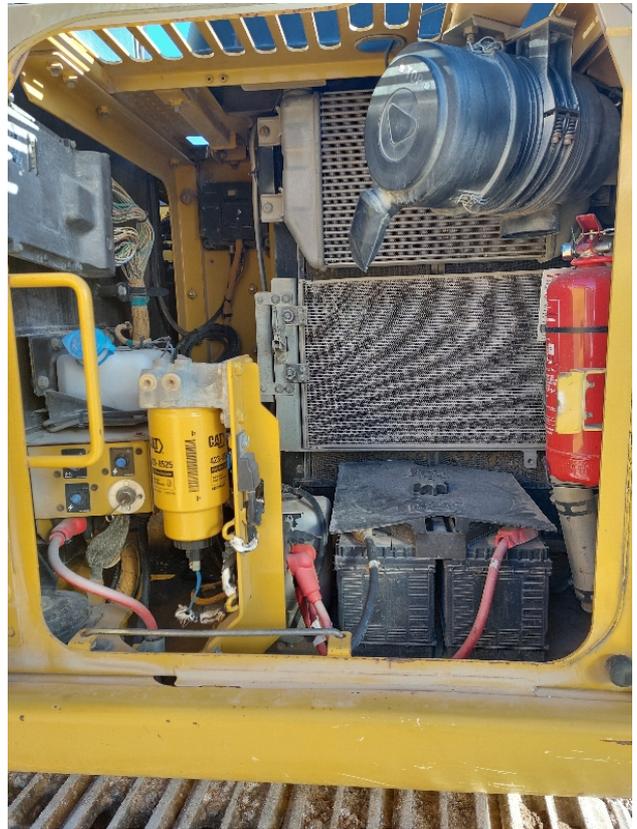



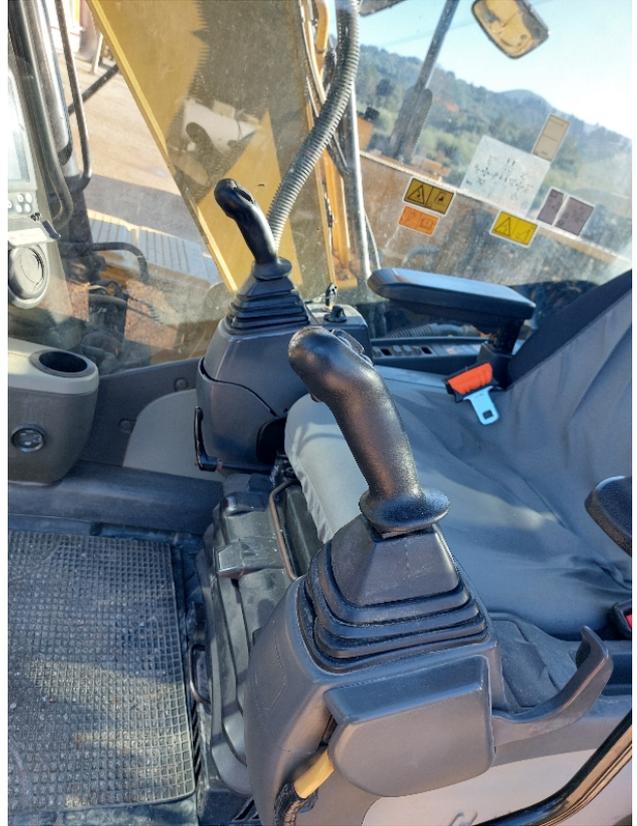

◆ Painting Conditions Good

◆ Counterweight conditions: Good

◆ Frame/Bumper conditions: Good

TRUCK

◆ Sprockets residual: 40

◆ Front idler wheel residual: 40

◆ Rollers upper/bottom residual: 30

◆ Chains residual: 30

Right side

◆ Door conditions (right): Good

◆ Spar conditions: Poor

◆ Other issues: Lieve Ammacatura

Left side

◆ Door conditions (left): Good

◆ Door conditions (left): Good

◆ Spar conditions (left): Good

◆ Hood/Armor bottom conditions: Present and bash

Functionality

Engine & electrical system functionality

- ◆ In quale stato è stata visionata la macchina: Accesa e provata per ispezione

- ◆ Engine working conditions: Good

- ◆ Engine with oil leaks: No
If Yes, where : Trasudi

- ◆ Engine presents blowby: No

- ◆ Oil-Water presence: No

- ◆ Engine present smokiness: No

- ◆ Radiator conditions: Good

- ◆ Starter motor conditions: Good

- ◆ Batteries/Cables conditions: Poor

- ◆ Presence of electrical fault: No

Functionality drive and rotation

- ◆ Hydraulic pump conditions: Good

- ◆ Engine rotation conditions: Good

- ◆ Engine travel conditions: Good

- ◆ Final drives conditions: Good

- ◆ Hydraulic joint conditions: Good
Presence of leaks : No

- ◆ Hydraulic joint conditions: Good

Presence of leaks : No

◆ Annotazioni su: Ralla lieve gioco nella norma

Linkage Group

◆ Hydraulic conditions linkage group: No

◆ Boom structure: Good

Presence of welding/cracks : No

◆ Stick structure: Good

Presence of welding/cracks : No

◆ Flexible pipes conditions: Good

◆ Boom cylinders conditions: Good

Leaks : Yes

◆ Stick cylinder conditions: Good

Leaks : No

◆ Bucket cylinder conditions: Good

Leaks : No

◆ Pins & Bushings boom conditions: Good

◆ Pins & Bushings stick conditions: Good

◆ Pins & Bushings bucket conditions: Good

◆ Bucket & Get conditions: Good

◆ Quick Coupler conditions: Good

◆ Auto Lube working conditions: No

◆ Annotazione sul gruppo caricatore: Lieve gioco braccio/stick nella norma

Cabin and Tools

- ◆ Conditions internal cabin: Good

- ◆ Flashing presents issues: No

- ◆ Lights & Windshield present issues: Presents and functioning

- ◆ Air conditioning is working: Presente e funzionante

- ◆ Back & side camera conditions: Present and functioning

- ◆ Annotazioni su: Da sostituire chiusura porta oggetti

Check 81/2008

- ◆ Glass conditions: Excellent - no needs repair

- ◆ Lights conditions: Excellent - no needs repair

- ◆ Rear view mirrors conditions: Excellent - no needs repair

- ◆ Stepladders & handrails conditions: Good

- ◆ Cameras conditions: Excellent - no needs repair

- ◆ Flashing conditions: Not functioning

- ◆ Safety belt conditions: Present and expired

- ◆ Controls been modified: No

- ◆ Presence of Exclusion Control Lever: Yes

- If No, are control levers protected to accidental functionality? : Yes

- ◆ Are Tools Functional & Visible with tag: Yes

- ◆ Canopy completed and comes with keys and bolt: Yes

- ◆ All Pipes with no damage e/o scratches: Yes

- ◆ Batteries box shielded: Yes

- ◆ Acoustic alarm works properly: Yes

- ◆ Boardwalk presence: Present and bashee

Valutazione Macchina

★ Non Funzionante (NF)

La macchina si presenta non funzionante e/o in pessime condizioni. Macchina da demolire o venduta per parti di ricambio. La macchina NON è in sicurezza.

★★ Scarso (S)

La macchina è in cattivo stato e può presentare visibili rotture e/o crepe su tutta la struttura. Per il suo ottimale funzionamento, o per essere avviata, può necessitare di importanti riparazioni a carro/gomme, perdite d'olio, riverniciatura completa, componenti principali, messa in sicurezza.

★★★ Buono (B)

La macchina si presenta in buone condizioni sia estetiche che di funzionamento. Carro/Gomme hanno orientativamente un 30/40% di vita residua. La macchina non presenta importanti rotture e/o perdite d'olio. La macchina è pronta per lavorare "AS IS" anche se potrebbe richiedere piccoli interventi di riparazione/migliorie. La macchina è in sicurezza.

★★★★ Molto Buono (O)

La macchina si presenta in condizioni molto buone, non ha più di 5 anni e/o 5000 ore lavorate. Non presenta problemi strutturali e può essere preparata esteticamente per renderla "quasi nuova". Componenti principali non inferiori al 50/60% di vita residua, macchina in sicurezza.

★★★★★ Eccellente (E)

La macchina si presenta in condizioni eccellenti, prossime al nuovo. Componenti principali non inferiori al 70/80% di vita residua, macchina in sicurezza.

Machine Rating

★ Not Working (NW)

Machine not operational or in really bad conditions. Machine has to be demolished or sold as a "parts". Machine not in security conditions.

★★ Poor (P)

Machine in bad condition, got visible cracks or repairable structural issues. Machine is operational but, in order to work properly, it may need significant repairs to tyres/truck, paint, pins and/or bushings, power train, hydraulic system.

★★★ Good (G)

Machine is in good condition and operational, with no structural issues. Tyres/Track around 30/40% of residual life. No relevant hydraulic leaks, pins/bushings with normal wear, frame may need to be repainted. Machine is ready to work "AS IS", it may need minor repairs for a better performance. Machine in security conditions or easy to be in safety condition.

★★★★ Very Good (VG)

Machine is in very good conditions, with no more of 5 years and/or 5000 working hours. No structural issues; painting condition is almost perfect. May need an easy check to be sold as "Brand New". Main components with 50/60% of life residue. Machine in security conditions.

★★★★★ Excellent (E)

Machine is in excellent condition, comparable to a new one. Main components-with 70/80% of life residue. Machine in security conditions.