

SALES REPORT: CATERPILLAR 324E - SN LDG00563 - Year 2015

This Report is a summary about observations came out from technical inspection done by our specialised technician.

GENERAL CONDITIONS

MACHINE DATA

Model: 324E

Family: MEDIUM EXCAVATOR

Serial Number: LDG00563

Order Number MU/MM: MU00813471

Construction year: 2015

Hour meter: 10430

General residual conditions Truck/Tyres: 40 %

Machine main application: Basic application

Location: Stock SASSARI

Rating: ★★☆☆☆

Public price: Ask


MACHINE CONFIGURATION


● Machine type Standard ● Boom type Mono boom ● Boom check valves ● Stick check valves ● Plant features Hammer line impianto versatility (linea media/alta pressione + rotazione) impianto dedicato all'attacco rapido ● Quick coupler Hydraulic CW 40 S ● Bucket Standard MM 1400 Get undefined ● Truck type Fixed ● General Truck Residual 40% ● Cabin type Fixed standard ● Air Conditioning system ● Product Link ● 26000 Kg ● CE Mark ● CE Certificate ● Use and maintenance manual



MACHINE PHOTOS

◆ Il contaore è:

Funzionante

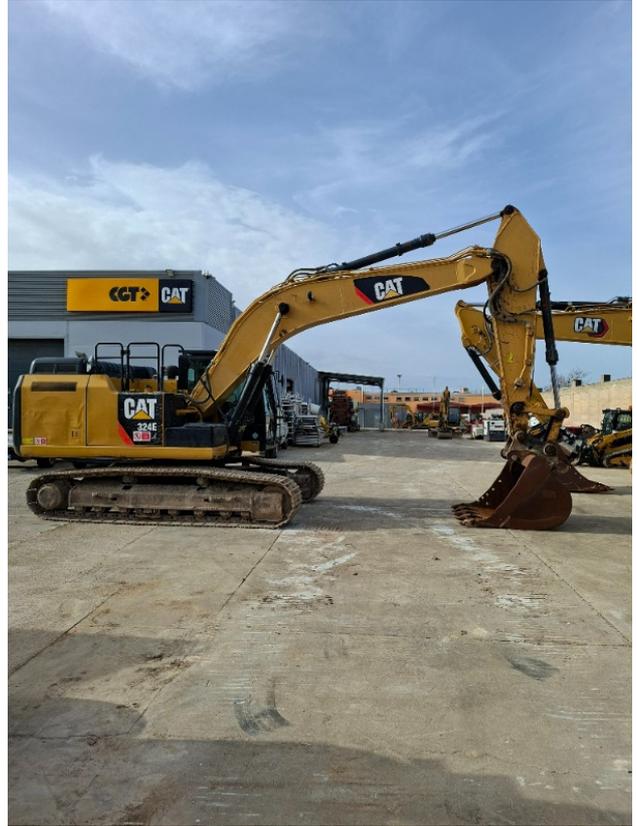

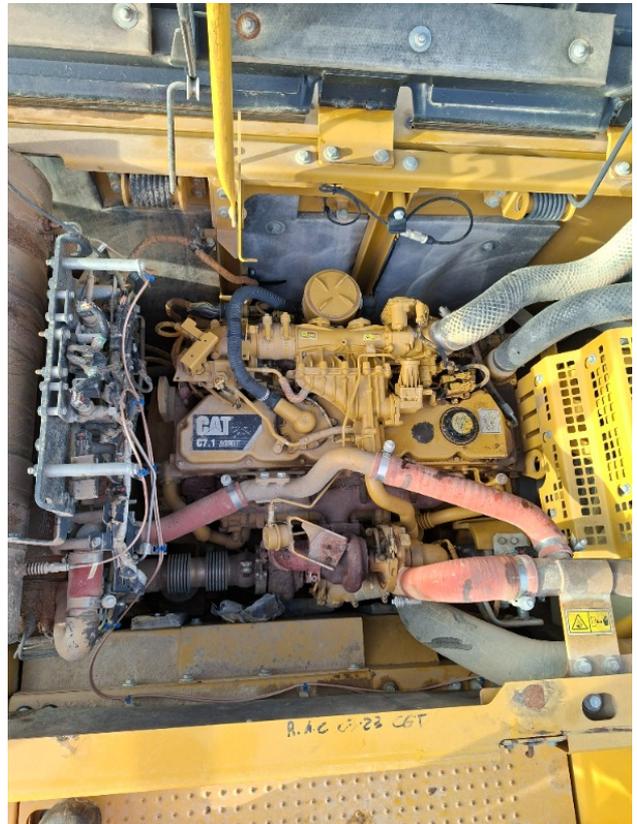

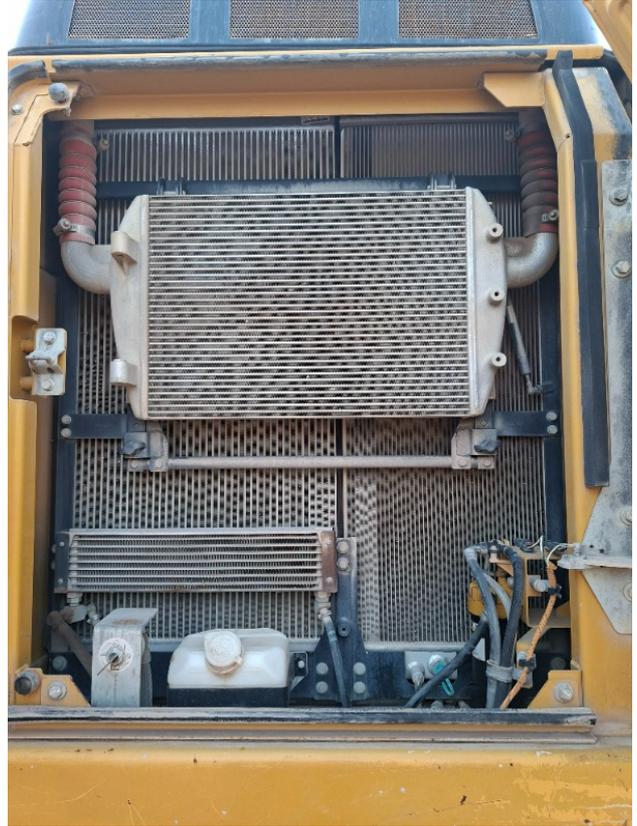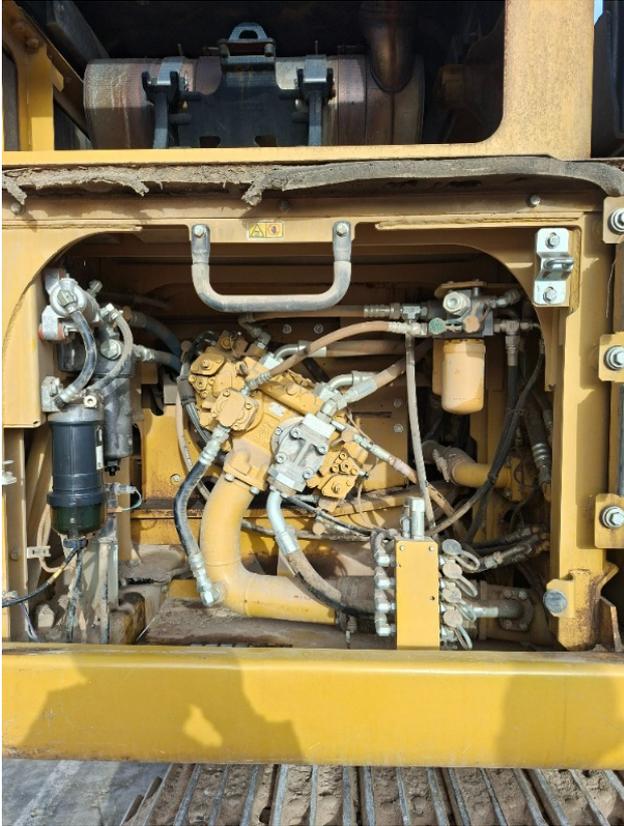

GENERAL APPEARANCE

◆ Painting Conditions Poor

◆ Counterweight conditions: Good

◆ Frame/Bumper conditions: Good

TRUCK

◆ Sprockets residual: 20

◆ Front idler wheel residual: 40

◆ Rollers upper/bottom residual: 40

◆ Chains residual: 40

Right side

◆ Door conditions (right): Poor

◆ Spar conditions: Poor

◆ Other issues: AMMACCATURE SU COFANO POMPA IDR. E SU LONGHERONE

Left side

◆ Door conditions (left): Good

◆ Door conditions (left): Good

◆ Spar conditions (left): Good

◆ Hood/Armor bottom conditions: Present and intact

Functionality

Engine & electrical system functionality

- ◆ In quale stato è stata visionata la macchina: Accesa e funzionante "al lavoro"

- ◆ Engine working conditions: Good

- ◆ Engine with oil leaks: Yes
If Yes, where : COPERCHIO DISTRIBUZIONE

- ◆ Engine presents blowby: Yes

- ◆ Oil-Water presence: No

- ◆ Engine present smokiness: Yes, white

- ◆ Radiator conditions: Good

- ◆ Starter motor conditions: Good

- ◆ Batteries/Cables conditions: Good

- ◆ Presence of electrical fault: No

Functionality drive and rotation

- ◆ Hydraulic pump conditions: Good

- ◆ Engine rotation conditions: Good

- ◆ Engine travel conditions: Good

- ◆ Final drives conditions: Good

- ◆ Hydraulic joint conditions: Good
Presence of leaks : No

- ◆ Hydraulic joint conditions: Good

Presence of leaks : No

Linkage Group

- ◆ Hydraulic conditions linkage group: No

- ◆ Boom structure: Good
Presence of welding/cracks : No

- ◆ Stick structure: Good
Presence of welding/cracks : No

- ◆ Flexible pipes conditions: Good

- ◆ Boom cylinders conditions: Good
Leaks : No

- ◆ Stick cylinder conditions: Good
Leaks : No

- ◆ Bucket cylinder conditions: Good
Leaks : No

- ◆ Pins & Bushings boom conditions: Good

- ◆ Pins & Bushings stick conditions: Good

- ◆ Pins & Bushings bucket conditions: Poor

- ◆ Bucket & Get conditions: Poor

- ◆ Quick Coupler conditions: Good

- ◆ Auto Lube working conditions: No

Cabin and Tools

| | |
|---------------------------------------|--------------------------|
| ◆ Conditions internal cabin: | Good |
| ◆ Flashing presents issues: | No |
| ◆ Lights & Windshield present issues: | Presents and functioning |
| ◆ Air conditioning is working: | Presente e funzionante |
| ◆ Back & side camera conditions: | Present and functioning |

Check 81/2008

| | |
|--|--|
| ◆ Glass conditions: | Broken or Chipped - needs repair |
| ◆ Lights conditions: | Excellent - no needs repair |
| ◆ Rear view mirrors conditions: | Excellent - no needs repair |
| ◆ Stepladders & handrails conditions: | Good |
| ◆ Cameras conditions: | Excellent - no needs repair |
| ◆ Flashing conditions: | Not functioning |
| ◆ Safety belt conditions: | Present and expired |
| ◆ Controls been modified: | No |
| ◆ Presence of Exclusion Control Lever: | Yes |
| | If No, are control levers protected to accidental functionality? : Yes |
| ◆ Are Tools Functional & Visible with tag: | Yes |
| ◆ Canopy completed and comes with keys and bolt: | Yes |
| ◆ All Pipes with no damage e/o scratches: | Yes |
| ◆ Batteries box shielded: | Yes |

◆ Acoustic alarm works properly: Yes

◆ Boardwalk presence: Present and functioning

Valutazione Macchina

★ Non Funzionante (NF)

La macchina si presenta non funzionante e/o in pessime condizioni. Macchina da demolire o venduta per parti di ricambio. La macchina NON è in sicurezza.

★★ Scarso (S)

La macchina è in cattivo stato e può presentare visibili rotture e/o crepe su tutta la struttura. Per il suo ottimale funzionamento, o per essere avviata, può necessitare di importanti riparazioni a carro/gomme, perdite d'olio, riverniciatura completa, componenti principali, messa in sicurezza.

★★★ Buono (B)

La macchina si presenta in buone condizioni sia estetiche che di funzionamento. Carro/Gomme hanno orientativamente un 30/40% di vita residua. La macchina non presenta importanti rotture e/o perdite d'olio. La macchina è pronta per lavorare "AS IS" anche se potrebbe richiedere piccoli interventi di riparazione/migliorie. La macchina è in sicurezza.

★★★★ Molto Buono (O)

La macchina si presenta in condizioni molto buone, non ha più di 5 anni e/o 5000 ore lavorate. Non presenta problemi strutturali e può essere preparata esteticamente per renderla "quasi nuova". Componenti principali non inferiori al 50/60% di vita residua, macchina in sicurezza.

★★★★★ Eccellente (E)

La macchina si presenta in condizioni eccellenti, prossime al nuovo. Componenti principali non inferiori al 70/80% di vita residua, macchina in sicurezza.

Machine Rating

★ Not Working (NW)

Machine not operational or in really bad conditions. Machine has to be demolished or sold as a "parts". Machine not in security conditions.

★★ Poor (P)

Machine in bad condition, got visible cracks or repairable structural issues. Machine is operational but, in order to work properly, it may need significant repairs to tyres/truck, paint, pins and/or bushings, power train, hydraulic system.

★★★ Good (G)

Machine is in good condition and operational, with no structural issues. Tyres/Track around 30/40% of residual life. No relevant hydraulic leaks, pins/bushings with normal wear, frame may need to be repainted. Machine is ready to work "AS IS", it may need minor repairs for a better performance. Machine in security conditions or easy to be in safety condition.

★★★★ Very Good (VG)

Machine is in very good conditions, with no more of 5 years and/or 5000 working hours. No structural issues; painting condition is almost perfect. May need an easy check to be sold as "Brand New". Main components with 50/60% of life residue. Machine in security conditions.

★★★★★ Excellent (E)

Machine is in excellent condition, comparable to a new one. Main components-with 70/80% of life residue. Machine in security conditions.